



Installation guide

GeoMax Zoom75/95 Series





Table of contents

1	INTRODUCTION	3
2	BATTERY CHARGING	3
	Zoom75/95 instrument Field controller	
3	PREPARATION OF THE INSTRUMENT	4
3.1	System files	4
3.2	Uploading the system files to the instrument	5
3.3	Loading license files	6
	Configuration of the communication port	
3.5	Install USB driver for Zoom75/95	7
3.6	Installing 3 rd party software onboard the instrument	8

1 INTRODUCTION

This guide provides complete step-by-step instructions for preparing the Zoom75/95 TPS series for measuring work. The instructions cover all the required installation tasks for the Zoom75/95 instruments.

The latest versions of GeoMax documents and software referred to in this document are all available from the Technical Library of the GeoMax Parner Area in the Zoom75/95 folder at: www.geomax-positioning.com/partner-area

Only the tasks required for the initial setup of a new Zoom75/95 system are described in this document. For further information regarding the operation of the Zoom75/95 components, please refer to the respective User Manual.

- The Zoom75/95 Quick Guide is included with the container set. The comprehensive User Manual for the TPS instrument is available from the included USB stick and also from Technical Library in the Zoom75/95 folder at <u>www.geomax-positioning.com/partner-area</u>
- The appropriate uses of the included accessories are described in the User Manual.

2 BATTERY CHARGING

2.1 Zoom75/95 instrument

Before using the instrument, the included ZBA400 battery should be charged. Insert the battery into the ZCH201 charger and plug the adapter into an AC power supply. Do not disconnect from power until the green FULL indicator flashes, indicating that the battery is fully charged. Once charged, insert the battery into the side cover slot of the Zoom75/95 instrument and switch on.

2.2 Field controller

The Field Controller is supplied in a cardboard box which includes the device, battery and charging adapter. Insert the supplied battery into the battery compartment of the device. Charge the internal battery with the supplied adapter. Do not disconnect from power until the battery is fully charged.

3 PREPARATION OF THE INSTRUMENT

3.1 System files

When receiving a new instrument, it should be checked that the latest firmware version is installed. The installed version can be viewed in the installed "GeoMax Toolkit" application. To access, start "GeoMax Toolkit" and select "SysInfo" (2). Select the second tab-page to view the version information. If this version does not match the one available from GeoMax Technical Library, then the instrument should be updated.



GeoMax Toolkit	
SYSTEM INFO	×
Page 1 Page 2 Page 3	
GeoMax Toolkit:	5.00.22
WinCE Version :	7.00.2882
Boot Version :	7.00
EFI Version :	1.00.5
SB Version :	7.0.2
EDM Version :	7.0.2
KDM Version :	1.0.5
	ОК

To customize the instrument according to personal preferences, the respective languages can be installed. The necessary files can be obtained from the Thechnical Library of the GeoMax partner area in the Zoom75/95/Firmware folder and have the following format:

- **Zoom75_95_v.XXXX.fw** is the main OS and application firmware file which by default comes in English.
- **GeoMaxToolkit_en_us.sus** an example language file when "en" indicates the English language and "us" stands for United States.

Name	Size	Type	Date Modified		
GeoMaxTookit_bg_bg	593 bytes	SBG File	2/2/2021 12:29 PM		
GeoMaxTookit_cs_cz	599 bytes	SCS File	2/2/2021 12:29 PM		- 1
A GeoMaxTookit da dk	603 bytes	SDA File	2/2/2021 12:29 PM		
GeoMaxToolkit_de_de	20.8KB	SDE File	2/2/2021 12:29 PM		
GeoMaxToolkit_el_gr	21.6KB	SEL File	2/2/2021 12:29 PM		
GeoMaxToolkit en us	670 bytes	SUS File	2/2/2021 12:29 PM		
GeoMaxToolkit_es_es	20.3KB	SES File	12/14/2020 2:47 PM		
GeoMaxToolkit_fi_fi	17.7KB	SFI File	2/2/2021 12:29 PM		
GeoMaxToolkit_fr_fr	20.9KB	SFR File	2/2/2021 12:29 PM		
GeoMaxToolkit_hu_hu	578 bytes	SHU File	2/2/2021 12:29 PM		
GeoMaxToolkit_it_it	20.5KB	SIT File	2/2/2021 12:29 PM		
GeoMaxToolkit_ko_kr	558 bytes	SKO File	2/2/2021 12:29 PM		
GeoMaxToolkit_lv_lv	593 bytes	SLV File	2/2/2021 12:30 PM		
GeoMaxToolkit_nl_nl	20.7KB	SNL File	2/2/2021 12:30 PM		
GeoMaxToolkit_nn_no	587 bytes	SNO File	2/2/2021 12:30 PM		
GeoMaxTookit_pt_br	20.9KB	SBR File	2/2/2021 12:30 PM		
GeoMaxToolkit_pt_pt	2.09KB	SPT File	2/2/2021 12:30 PM		
GeoMaxTookit_ro_ro	588 bytes	SRO File	2/2/2021 12:30 PM		
GeoMaxTookit_ru_ru	21.2KB	SRU File	2/2/2021 12:30 PM		
GeoMaxToolkit_sk_sk	581 bytes	SSK File	2/2/2021 12:30 PM		
GeoMaxToolkit_sv_se	587 bytes	SSV File	2/2/2021 12:30 PM		
Zoom75 95 5.0.22	129.9MB	FW File	3/3/2021 3:51 PM		

3.2 Uploading the system files to the instrument

The system files are loaded into the instrument directly from the SD card or USB stick. Therefore, copy all downloaded files to the **System** directory of the SD card/USB stick. Insert the SD card/USB stick into the corresponding port on the communication side cover of the instrument and switch on the instrument. To upload files to the instrument, start GeoMax Toolkit and navigate to **MAIN MENU / APPS / UPDATE**. If the firmware needs to be upgraded, install it first by selecting **F1 Firmware**. Then install the preferred language file by selecting F2 Language.



Geo	Max Toolkit	
UPDA	TE	x
F1	Firmware	(1)
F2	Language	(2)
F3	Key	(3)
F1	F2 F3	

Note: Ensure that fully charged batteries are inserted when uploading firmware. This process can take some time and the power supply must NOT be interrupted during the loading process. During the update process, it could be that the instrument will automatically reboot a couple of times.

3.3 Loading license files

Some functions are licence protected and require a licence key to be uploaded. To upload a licence key file, navigate to **MAIN MENU / APPS / UPDATE / F3 Key** and select the required file for uploading. The key files are loaded directly from the SD card or USB stick, therefore, copy the file to the **System** directory of the SD card/USB stick.

Geo	Max Toolkit	
UPDA	TE	X
F1	Firmware	(1)
F2	Language	(2)
F3	Кеу	<mark>(</mark> 3)
F1		

3.4 Configuration of the communication port

Zoom75/95 supports three communication options that can be configured as follow:

Serial connection. If the optional ZDC229 data transfer cable has been purchased, a serial connection can be established between the Zoom75/95 and the PC; to enable this communication port, go to MAIN MENU / SETTINGS / COMM and select the RS232 option.

In addition, in order to use the ZDC229 data transfer cable, it is necessary to install a driver on the PC which can be obtained from the GeoMax Partner Area Technical Library in the Zoom75/95/Drivers folder under the name 'Zoom75&Zoom95 USB Driver'. After downloading it, run the corresponding .exe file and follow the instructions of the installer application to complete the process. Once the installation is complete, you can connect the serial port of the Zoom75/95 to the PC using the serial cable.

- Internal Bluetooth. To enable the internal Bluetooth of the Zoom75/95 for connection, go to MAIN MENU / SETTINGS / COMM and select the 3rd option by clicking on OK button.
- **Bluetooth Handle.** If the ZRT82 long range Bluetooth handle is going to be used for connection, replace the standard instrument handle with it. Swing the antenna into the

upright position. To configure the handle, choose **MAIN MENU / SETTINGS / COMM**. If the handle is recognized, the "Bluetooth Handle (ZRT82)" option should be available, and if the 'Power' LED on the handle is green, then select the option and click OK to enable it. In case the 'Power' LED is off, perform a Windows reset by pressing the power key and selecting the corresponding option; after the reset, the 'Power' LED on the handle will turn green and the Bluetooth connection can be activated as just described.

GeoMax To	oolkit		GeoMax To	oolkit	
MAIN MENU		×	SETTINGS		×
Œ	1		~		
1 Level	2 Sysinfo	3 Settings	1 Unit	2 Date/Time	3 Comm.
4 Apps			4 Atmos.	5 Pin	

GeoMax Toolkit	
COMMUNICATION SETTINGS	x
Select the communication port	
RS232 Bluetooth Handle (ZRT82)	
Internal Bluetooth	
	ĸ

3.5 Install USB driver for Zoom75/95

The instrument is equipped with a mini USB connector behind the side-cover. This USB connection can be used to connect the Zoom75/95 to a PC to access its internal storage. Having this option is useful for dragging and dropping files between your Zoom75/95 and the Dekstop PC. In order to the PC to recognize the Zoom75/95, the USB driver of Zoom75/95 must be installed. To install it, do the following:

- Download the 'Zoom75 & Zoom95 mini-USB to USB driver' from the Zoom75/95/Drivers folder at GeoMax Partner Area Technical Library.
- Make sure the Zoom75/95 is not connected to the PC

- Run the Setup_GeoMax_USB_xx.EXE
- Follow the instructions on the screen
- When ready, press FINISH
- Power ON the Zoom75/95
- Connect the Zoom75/95 to the PC with a USB cable. Your PC will then try to recognize the Zoom75/95 and associate the appropriate drivers with it.
- Press the Windows Start button at the bottom left corner of the screen of the PC
- Type the IP address of the device into the search field: \\192.168.254.3\
- Press Enter. A file browser opens with access to the folders of the instrument.

If connection is not possible, please refer to the **'How to get Zoom75/95 USB driver running on Windows10'** guide, which can be find at the Technical Library in Zoom75/95 folder.

3.6 Installing 3rd party software onboard the instrument

With the Zoom75/95 it is possible to install applications onto the unit if they were specifically designed for it. If the received application installer is in .CAB format, it means that it has to be transferred to the Zoom75/95 first before it can be installed. There are multiple ways of doing this, but the easiest thing would be to put the .CAB file directly onto a USB-Stick and put this stick into the Zoom75/95 USB port. Then on the desktop screen of the Zoom75/95, double-tap on the MY DEVICE icon. Navigate to the USB stick and press ENTER. Now highlight the .CAB installer and press ENTER to start the installation. Follow the instructions provided on the screen.

If the received file is however an .EXE file, then it means that it would need to be run from the Desktop PC side. Make sure that the instrument is powered ON and connected to the Desktop PC. (See previous chapter). If the instrument is properly connected, run the .EXE file and follow the instructions on the screen.







1.0.0en

© 2021 GeoMax AG is part of Hexagon AB. All rights reserved.

> **GeoMax AG** Espenstrasse 135 9443 Widnau Switzerland

geomax-positioning.com

f in y D